


Assembly Instructions For 564.46436K

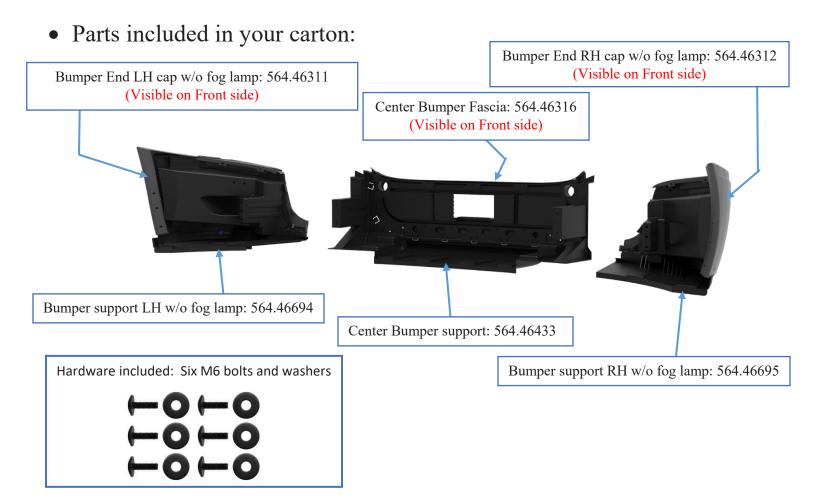


- Some helpful tips before we begin:
 - Tools required:
 - i) T30 Torx bit with 11 mm socket wrench or T30 torx screw driver.
 - ii) Couple of flat head screw driver.
 - Use padding under the bumpers while assembling it to avoid any scratches or dirt marks.
 - Completely assemble the bumper before mounting it on the truck.
 - Use Jack to stabilize the bumper while mounting it on the truck.
 - Please follow the individual notes mentioned with the steps below, for a hassle free assembly.






• Step 1: Removal of bolts from LH & RH bumper ends.

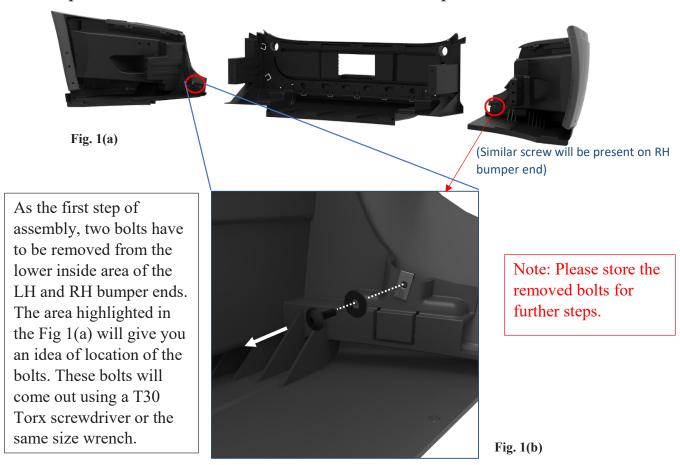

• Step 2: Assembling center bumper piece to LH and RH end bumpers.

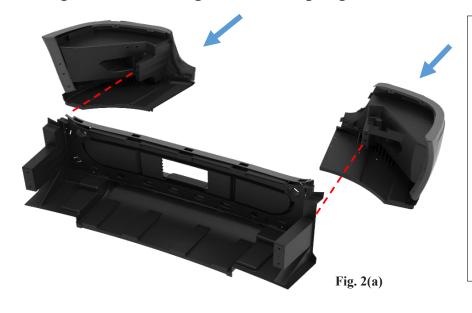

In this step, it is important to properly connect the bumper ends to center piece. The orientation of connection should be according to fig 2(a). The best way of connecting the bumpers is by placing the bumper ends on a padded base/ground and bringing the center piece on top of it.





Fig. 2(b)



Fig. 2(c)



Fig. 2(d)



Once the bumpers are overlapping, the clips shown in Fig. 2(b) has to be secured into the slots shown in Fig. 2(c). In the overlapped state, fist make sure that all the three clips and slots are aligning properly, after that push the clips into the slots. Make sure the clips are fastened properly inside the slots. Fig. 2(d) shows the way clips should appear on the other side after fastening.

Note: If disassembly is needed, please use two screwdrivers to pry the clip apart. One will be used to push the clip and other will be used to lift the tab. If not done carefully, you can break tab.



• Step 3: Fastening the bolts that were removed in Step 1.

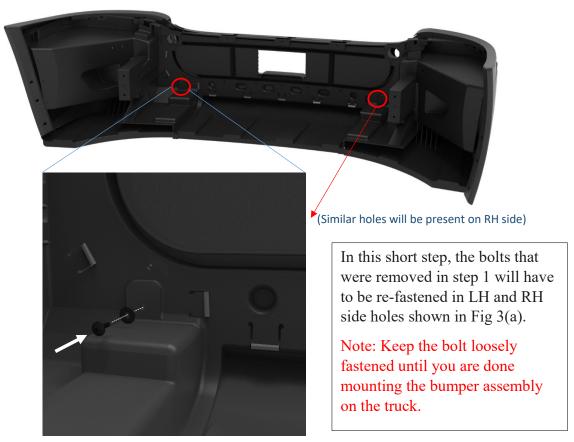


Fig. 3(a)

• Step 4: Fastening the bolts for the bottom-side of bumper ends.

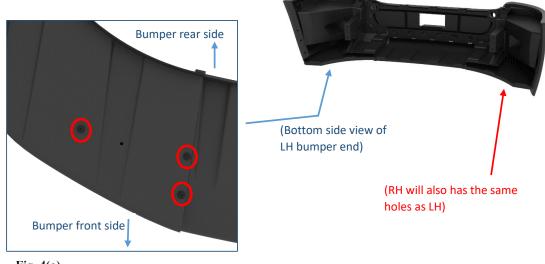


Fig. 4(a)






- In this step we will be using the 6 M6 bolts and washers that are provided inside the carton.
- We have to flip the bumper in the way that its underside is visible on the top. Over here, you will find four holes on both LH and RH ends. Out of the four holes, you have to fasten the M6 bolt and washer at the three holes that are marked in Fig 4(a). You will require the T30 Torx tool to fasten these bolts.

Note: Please do not tightly fasten these bolts. You will be tightening these bolts after the bumper is mounted on the truck.

• Step 5: Mounting the assembled bumper on the truck.

- You will mount the bumper on the truck using the holes 1 & 2 as shown in Fig 5(a). You can ignore the center hole.
- After that, you can fasten the bolts for bumper end support by using the holes 3 & 4. The same process goes for both the bumper ends.
- Once the bumper is mounted, you can then fasten the bolts from step 3.
- Lastly, you will still need to apply some pressure on the front side to align the center piece with the ends. After this step you can finally tighten the bolts from step 4.

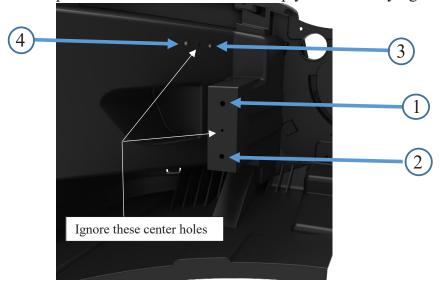

This way, you will conclude the assembly of your Freightliner bumper. Hope you found this instruction helpful.

Visit <u>www.Automann.com</u> for a complete listing of make-specific replacement parts and accessories.

Thank you for choosing Automann. We look forward to continue helping with all your trucking requirements.